

Work Order ID 115207

March-18-14 8:07:40 AM

115207

Page 1

Item ID: D2580-1

Revision ID:

Item Name: 205 Bent Tube

Start Date: 3/18/14

Start Qty: 8.00

8

Required Date: 4/01/14

Req'd Qty: 8.00

8

Reference:

Accept

N900040100

Setup Start

NS1

Stop

NS2

Cust Item ID:

Customer:

Approvals:

Process Plan: ML5

Date: 4-03-18

QC:

Date:

Tooling:

Date:

SPC (Y/N):

Date:

Run Start

NR1

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr

Revision Nbr

D2580

F

100

100

Skidtubes

Skidtubes

Memo

1- Inspect mat'l D2500-1-190 for damage

2-Drill pilot holes using drill jig DT 8149 A-BC-D

3-Open holes to 0.508" as per Dwg D2580

4-Deburr holes per QSI002 section 4.2.3 and blow out all chips from inside of tube

5- Test fit inspection saddles on FWD & AFT saddle holes using DT9916.

0.00

0.00

8 0

DGL

14-3-20

101

101

QC

Quality Control

QC6- Inspect dimensions to drawing

Memo

0.00

0.00

DAS
03
9-88

14-3-24

Work Order ID 115207

March-18-14 8:07:40 AM

115207

Page 2

Item ID: D2580-1

Revision ID:

Item Name: 205 Bent Tube

Start Date: 3/18/14 Start Qty: 8.00

Required Date: 4/01/14 Req'd Qty: 8.00

Reference:

Accept

N900040100Setup Start ***NS1***Stop ***NS2***

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____

QC: _____ Date: _____

Tooling: _____ Date: _____

SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***Sequence ID/
Work Center IDOperation
Description

110

Chemical Conversion Coat per QSI005 4.1

110

HandFinish

Hand Finishing

Memo

Set Up/
Run Hours

0.00

0.00

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

120

QC7-Inspect Chemical Conversion Coat

120

QC

Quality Control

Memo

0.00

0.00

125

125

Skidtubes

Skidtubes

Memo

1- Bond web in place per QSI 015.

A/R Sikaflex-291 batch: 128026

Sikaflex expire date: 14/10/19

Start time and date: 14-3-25

7:30

0.00

0.00

bond for 12hrs

14-3-25

JCL

Work Order ID 115207

March-18-14 8:07:40 AM

115207

Page 3

Item ID: D2580-1

Revision ID:

Item Name: 205 Bent Tube

Start Date: 3/18/14

Start Qty: 8.00

8

Required Date: 4/01/14

Req'd Qty: 8.00

8

Reference:

Accept

N900040100

Setup Start

NS1

Stop

NS2

Cust Item ID:

Customer:

Approvals:

Process Plan:

Date:

QC:

Date:

Tooling:

Date:

SPC (Y/N):

Date:

Run Start

NR1

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

130

QC5- Inspect part completeness to step on W/O

0.00

130

QC

Memo

0.00

Quality Control

140

Identify as per dwg & Stock Location: 46

0.00

140

Packaging

Memo

0.00

Packaging

150

QC21- Final Inspection - Work Order Release

0.00

150

QC

Memo

0.00

Quality Control

DAS
8-03
8-09

DP 14-3-25 (8)

DP 14-3-26

MLJ 14-03-26

MLJ 14-03-26

Picklist Print

March-18-14 8:07:44 AM

Page 1

Work Order ID: 115207

115207

Parent Item: D2580-1

D2580-1

Parent Item Name: 205 Bent Tube

Start Date: 3/18/14

Required Date: 4/01/14

Start Qty: 8.00

Required Qty: 8.00

Comments: IPP B01.11.08 Revised Step 9, 10, 12, and 13 SM
10.12.01 as per DEO D1 DD ver:ec

IPP Rev:C

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190		Manufactured		No		100	Each	57.0000	1	8			
-------------	--	--------------	--	----	--	-----	------	---------	---	---	--	--	--

D2500-1-190

Ext'n - I' Beam Tube 4"

Location

HALL

105279

Loc Qty

57

57

Loc Code

8 14-3-20 JCL

D2596		Manufactured		No		100	Each	4.0000	1	8			
-------	--	--------------	--	----	--	-----	------	--------	---	---	--	--	--

D2596

Web, 205 Skidtube

Location

LG002

110449

109898

114236

Loc Qty

4

4

4

Loc Code

14-3-25 JCL/DGL

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Design <input type="checkbox"/>											
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Handling/Pre <input type="checkbox"/>											
Material <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Offset/Setup <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Transport <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY			
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other


LIST OF MATERIALS					
ITEM	QTY -041	QTY -045	QTY -047	PART NUMBER	DESCRIPTION
1	X			D2580-041	SKIDTUBE ASSEMBLY
2		X		D2580-045	SKIDTUBE ASSEMBLY
3			X	D2580-047	SKIDTUBE ASSEMBLY
4	1	1	1	D2500-1-190	EXTRUSION
5			16	D2570	BUSHING
6	1	1	1	D2576-3	STEP
7		4		D2579	SPACER
8	16	16	8	D2594-1	PLUG
9	16	16	8	D2594-3	O-RING
10	1	1	1	D2596	205 WEB
11	1	1	1	D2855	AFT CAP
12	1	1		D3564-5	WEARSHOE
13	1	1		D3564-9	WEARSHOE
14	1	1		D3564-11	WEARSHOE
15	1	1		D3564-13	WEARSHOE
16	2	2		D3566-1	GASKET
17	1	1		D3566-5	GASKET
18	1	1		D3566-13	GASKET
19	20	20	24	D4202-1	SPACER
20			1	D4406-041	WEARPLATE ASSEMBLY
21			1	D4406-043	WEARPLATE ASSEMBLY
22	50	50		ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
23	50	50		AN3C4A	BOLT
24	2	2	2	AN3-5A	BOLT
25			8	AN4-45A	BOLT
26	50	50		NAS1149C0332R	WASHER (AN960C10L)
27	2	2	2	NAS1149D0332J	WASHER (AN960JD10L)
28			8	MS21042-4	NUT (OR MS21042L4)

GENERAL NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY (-041/-047) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.2
POWDER COAT ASSEMBLY (-045) GREEN SANDEX (REF 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 34.5 lbs
D2580-045 = 34.5 lbs
D2580-047 = 37.7 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/-291.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

RELEASED
2013-07-13


F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.06.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DC	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	DC		
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	DD	D2580	SHEET 1 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	HS	205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

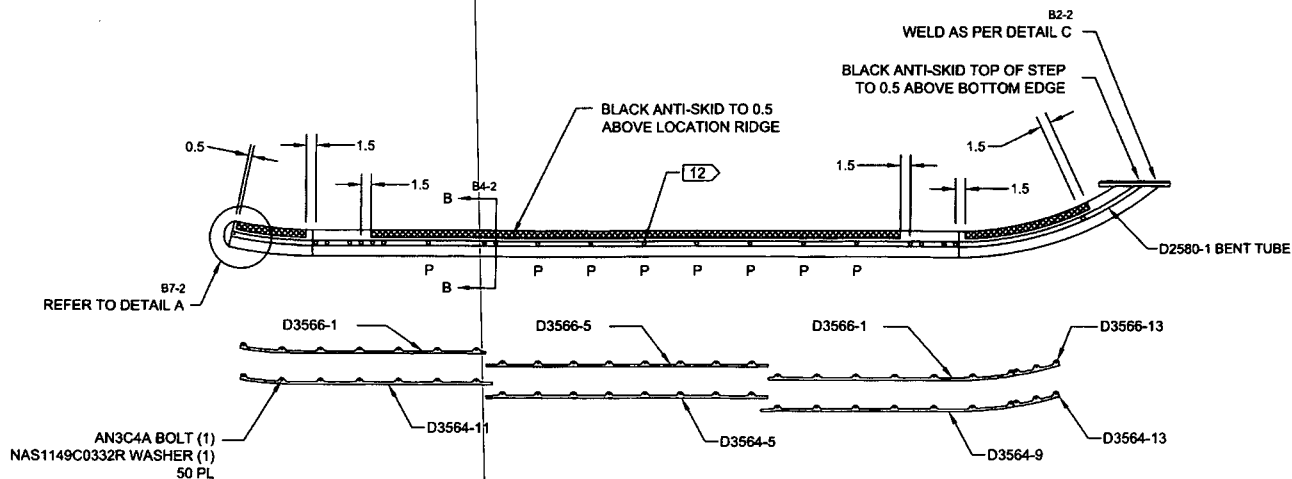


D2580-041 ASSEMBLY DETAIL

RELEASED
2013-07-15
WD

DETAIL A C7-2
SCALE 5X

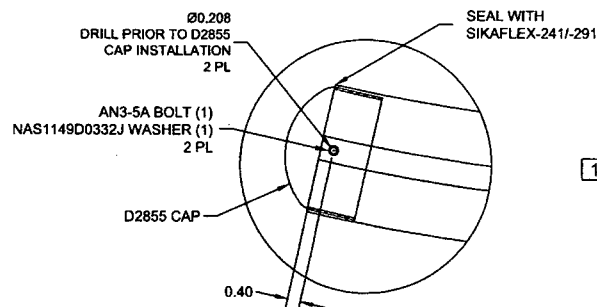


SECTION B-B D5-2
SCALE 5X

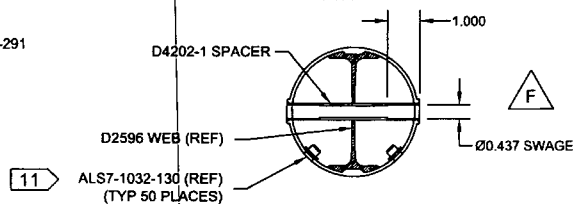


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

DETAIL C D3-2
SCALE 5X

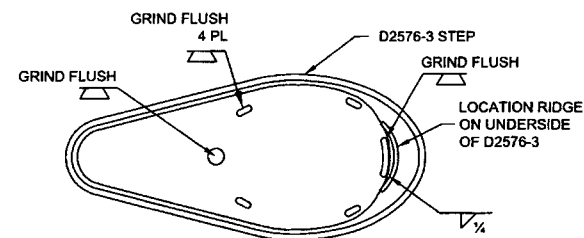


DESIGN	4	DART AEROSPACE LTD	
DRAWN	DC	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	DD	D2580	SHEET 2 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	4	205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

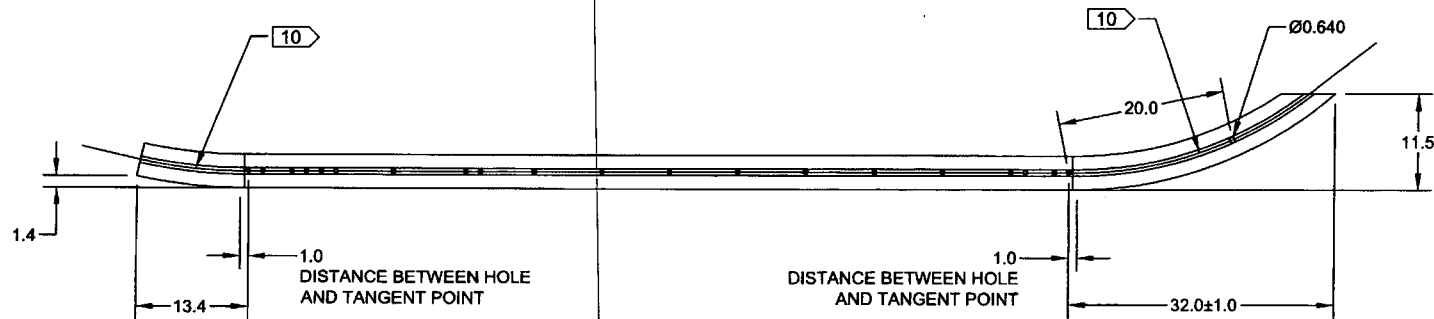

D2580-1 BENT TUBE
(MAKE FROM D2580-10T TUBE)

RELEASED
2013-07-15


DESIGN	DC	DART AEROSPACE LTD	
DRAWN	DC	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	DD	D2580	SHEET 3 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	HS	205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

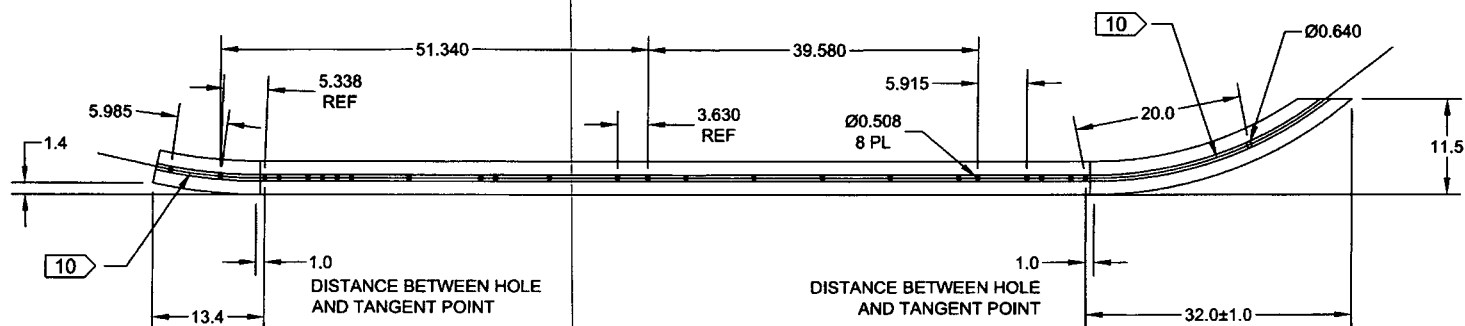

D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)




RELEASED
2013-07-15
MD

DESIGN	<i>DC</i>	DART AEROSPACE LTD	
DRAWN	DC	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	DD	D2580	SHEET 5 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	<i>HS</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	<small>COPYRIGHT © 1998 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	


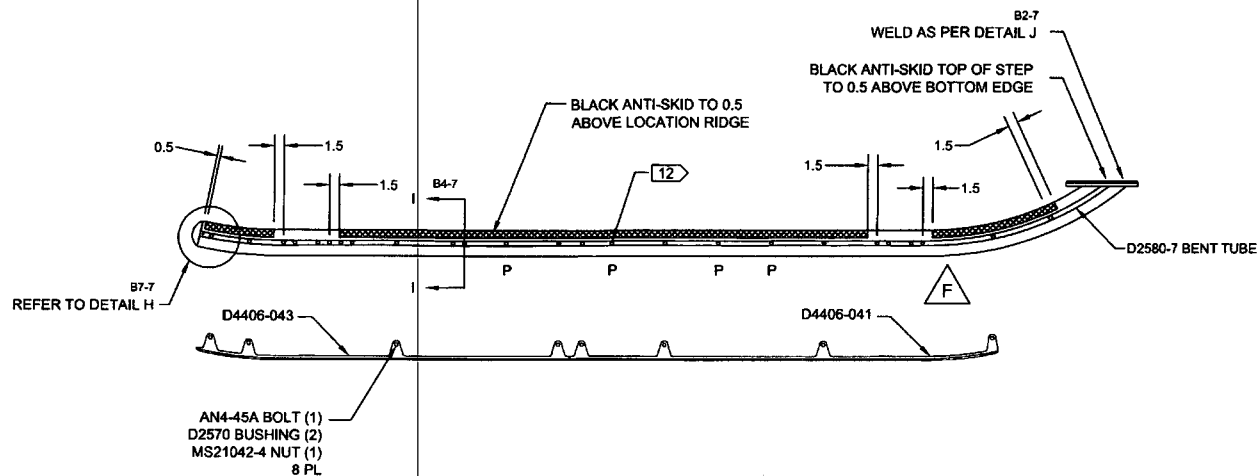


D2580-047 ASSEMBLY DETAIL

RELEASED
2013-07-15
WD

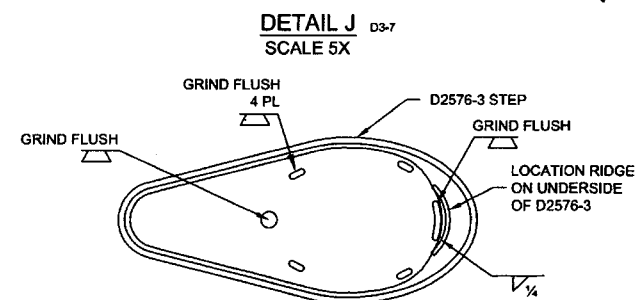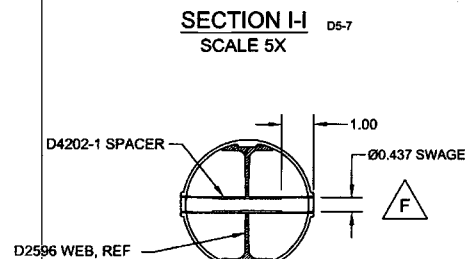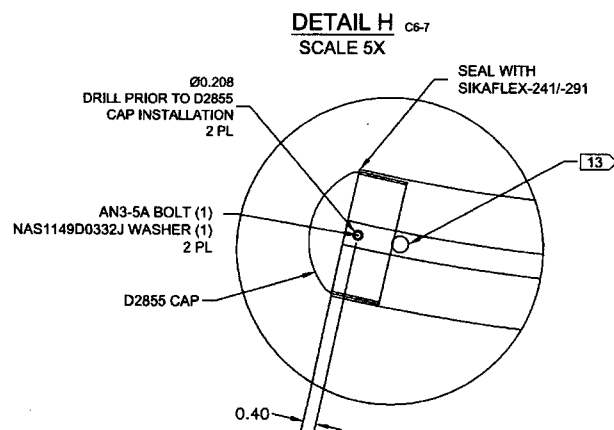

DESIGN	CH	DART AEROSPACE LTD	
DRAWN	DC	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	DD	D2580	SHEET 6 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	CH	205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

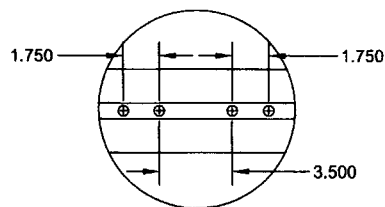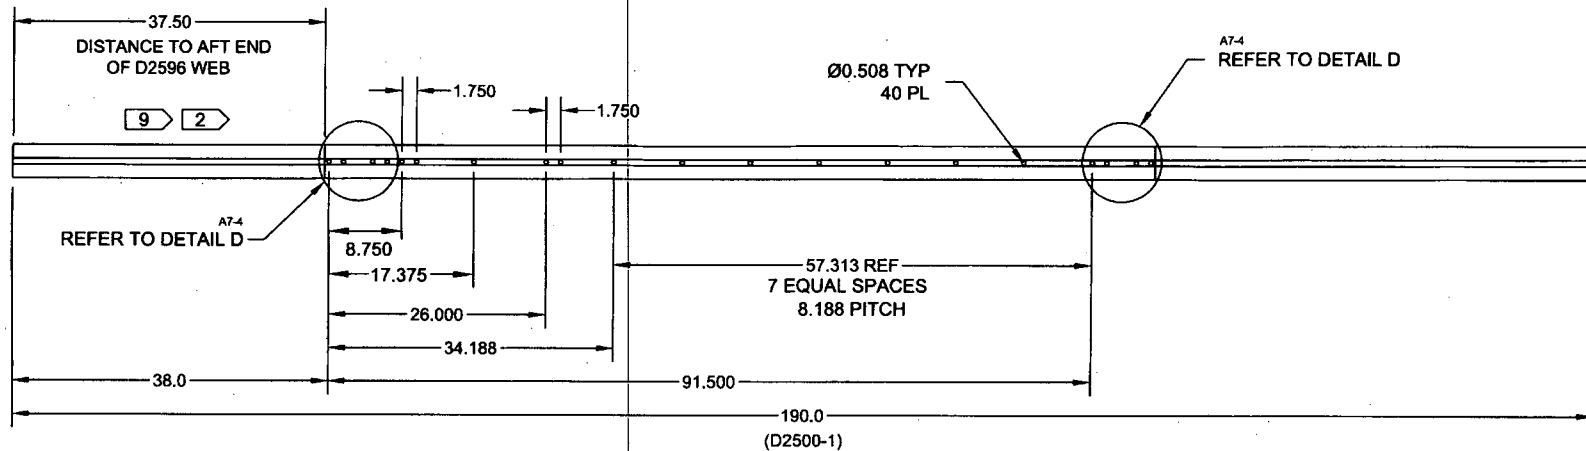

DETAIL D D3-4
SCALE 5X C7-4

D2580-101 TUBE

RELEASED
2013-07-15

DESIGN		DART AEROSPACE LTD	
DRAWN	DC	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	DD	D2580	SHEET 8 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	13.06.20	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	